



Installation guide for Seldén Soft attachment blocks



Lashing with knot



1. Thread the line through rivet, up through head, around attachment point and back down.



2. Lash the rope with two wraps and secure with carrick-knot.
For carrick-knot see page 2.



Warning

Always lash through the rivet and head of the block. Only lashing through head is not strong enough

Insert with loop




1. Put the loop around Insert, pull the loop through head, around attachment point and back down.



2. Put the other end of the loop around the insert, push the insert back inside to the centre of rivet.



Carrick-knot

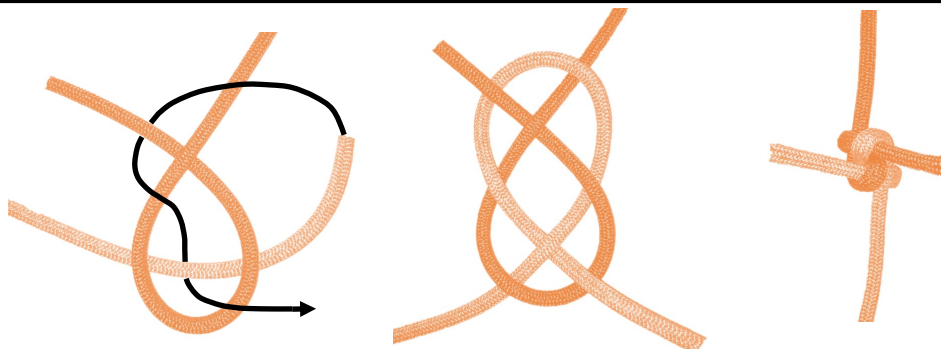


1. Thread the line as arrow indicates

2. Make sure there is enough line at the loose ends

3. Pull tight

Lashing around objects with large diameter

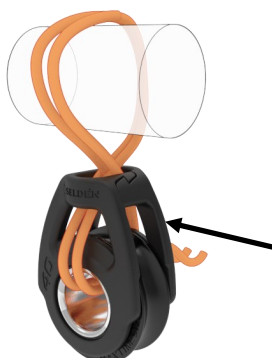

Make sure to cross lash the rope when attaching to objects with large diameter.

See closeup for example.

Insert and loop around objects with large diameter



Make sure to cross the loop when coming down through the head. Thread it in-between the previous wrap.

Registered Design 6134080 of Seldén Masts Limited